

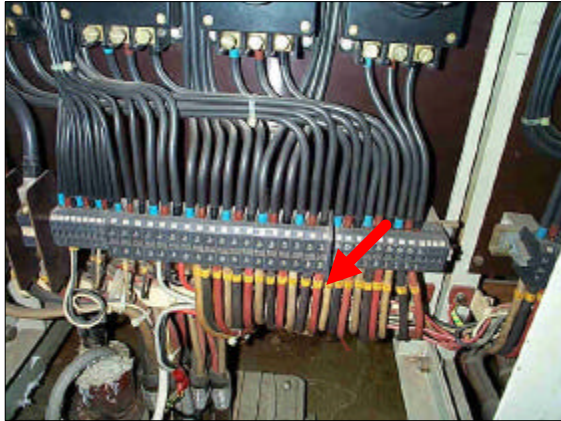


Fotografi

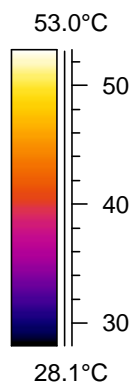

Sted	Emerg. Gen. room
Utstyr	EL.1061. Plint 31-32-33
Status	
Dato	5/19/00
Tid	11:32:07 AM

Termogram

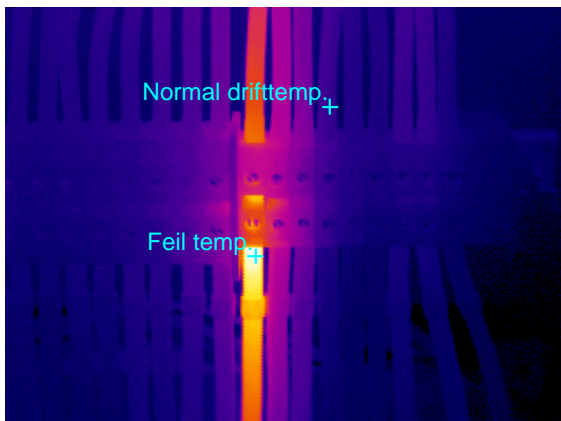

Temp. i feilsted	53 °C
Normal drift temp	31 °C
Overtemperatur	21 °C
Last i feilsted	
Merkelast	
Feilkategori	A

Anbefalt tiltak

Ettertrekke forbindelser.

Rep.kommentar

Dato for utbedring: _____ Sign.: _____



Kommentar: _____

Fotografi



Sted	Maskinrom
Utstyr	Proviantanlegg.
Status	
Dato	5/19/00
Tid	8:48:05 PM

Termogram

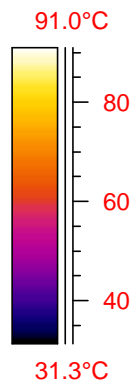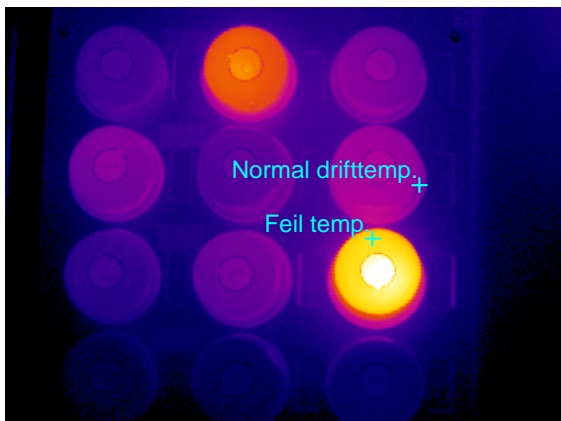

Temp. i feilsted	82 °C
Normal drift temp	44 °C
Overtemperatur	38 °C
Last i feilsted	
Merkelast	
Feilkategori	A

Anbefalt tiltak

Kontrollere bunnskrue.

Rep.kommentar

Dato for utbedring: _____ Sign.: _____

Kommentar: _____