

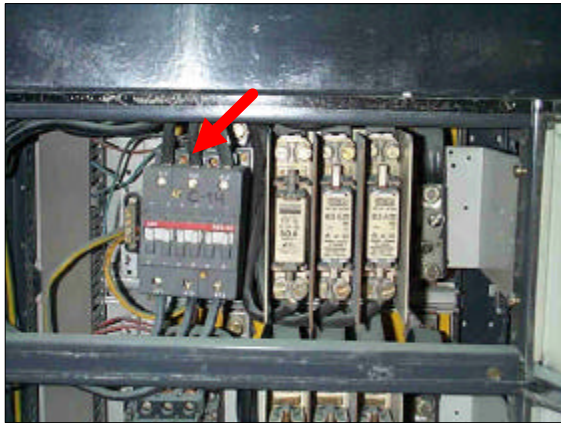


Fotografi

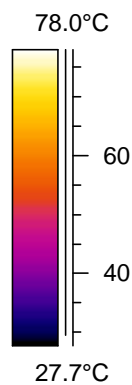

Sted	Varme 4- Hærdeovn
Utstyr	Kontaktor C14
Status	Dårlig kontakt
Dato	6/24/99
Tid	12:33:37 PM

Termogram

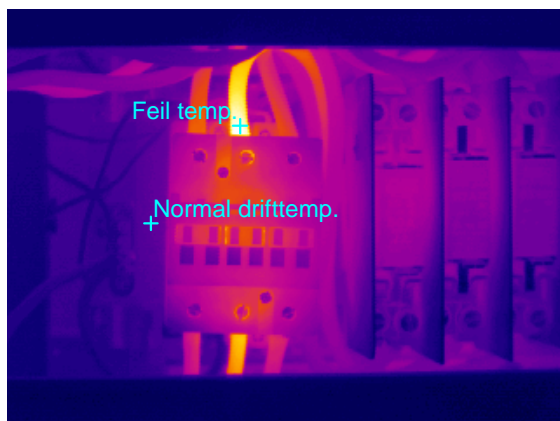

Temp. i feilsted	78 °C
Normal drift temp	37 °C
Overtemperatur	41 °C
Last i feilsted	
Merkelast	63 Amp
Feilkategori	A


Anbefalt tiltak

S- fas (midtre fas) ettertrekkes, samt kontaktflater kontrolleres.


Rep.kommentar

Dato for utbedring: _____ Sign.: _____

Kommentar: _____

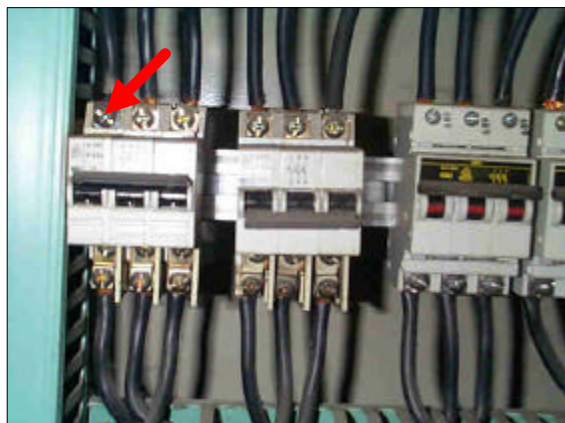Fotografi

Sted	F7- M021
Utstyr	Sikr. automat nr. 1
Status	Dårlig kontakt
Dato	6/25/99
Tid	9:14:24 AM

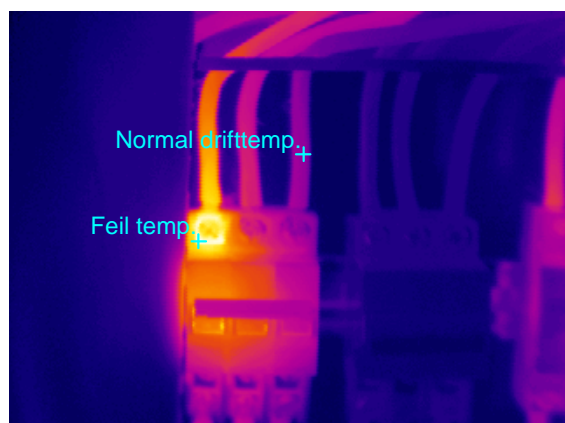Termogram

Temp. i feilsted	165 °C
Normal drift temp	62 °C
Overtemperatur	103 °C
Last i feilsted	
Merkelast	63 Amp
Feilkategori	A

Anbefalt tiltak

Ettretreke forbindelser.
Skifte ut ledere som har hatt høy temperatur.

Rep.kommentar

Dato for utbedring: _____ Sign.: _____

Kommentar: _____